

FM-TACH-ACRTBC - Digital Dual Output Tachometer, Face Mount, AC Powered, terminal block connections, single set point relay.

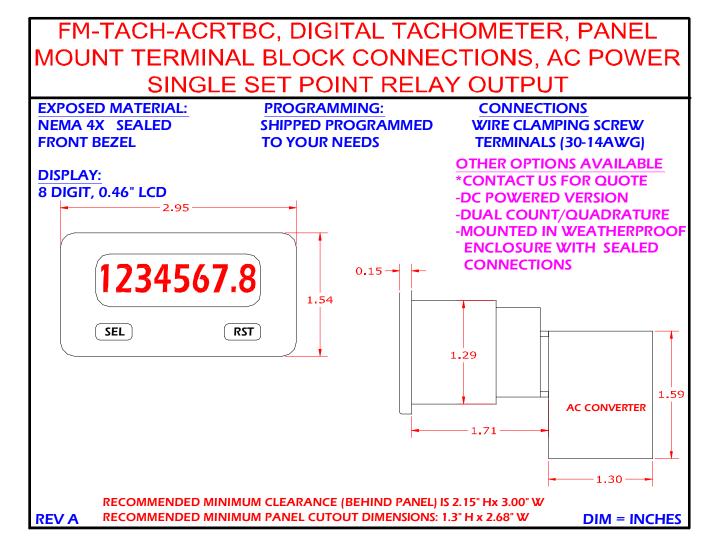

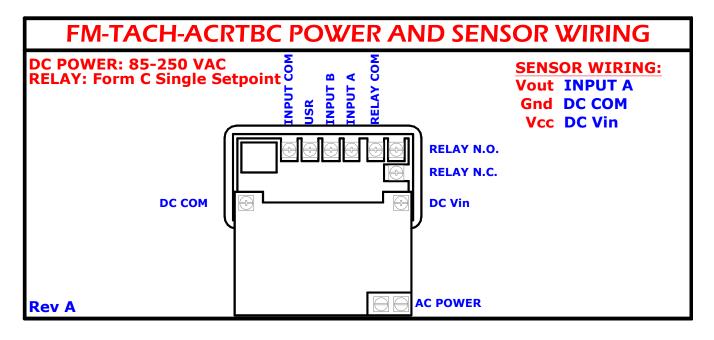

Sensor Solutions Corp. • V: (970) 879-9900 Fax: (970) 879-9700 • www.sensorso.com • rev A

FM-TACH-ACRTBC - Digital Dual Output Tachometer, Face Mount, AC Powered, terminal block connections, single set point relay.

TACH-ACR, Electrical & Functional Specification

ABSOLUTE MAX LIMITS	CONDITIONS	MAX	UNITS
Power	AC Input Voltage	120	Volts AC
Maximum Frequency	Operating	20	KHz
Minimum Frequency	Operating	0.01 (min)	Hz

ELECTRICAL SPECS	CONDITIONS	MIN	MAX	UNITS
Temperature Range	Operating	-35	+75	Deg C
Temperature Range	Storage/No Power	-35	+85	Deg C
Humidity	Operating/Storage	0	85	% RH
Vibration (x,y,z) direction	IEC 68-2-6		500	Hz
Shock (x,y,z) direction	IEC 68-2-27		40	g
Relay Contact Ratings	30 VDC resistive		1	Amp
Relay Contact Ratings	125 VAC resistive		0.3	Amp
Relay Response Time	Turn On or Off		4	mSec

PROGRAMMED PARAMETERS	MIN	MAX	PROGRAMMING	UNITS	
Rate: Unit of Measurement					
Rate: Scaling Display Value	0	999999			
Rate: Scaling Input Value	0.1	99999.9			
Rate: Low Update Time	0.1	99.9		sec	
Rate: High Update Time (zero)	0.2	99.9		sec	
Relay Setpoint	0.0	999999		Hz	
Relay State (N.C. @ zero speed)					
PROGRAMMED TO:	900-14				

Rev A

CAUTION: Power common (PWR COMMON) is NOT isolated from input common (INP COMM). In order to preserve the safety of the meter application, the power common must be suitably isolated from hazardous live earth referenced voltage; or input common must be at protective earth ground potential. If not, hazardous voltage may be present at the Signal or User Inputs and input common terminals. Appropriate considerations must then be given to the potential of the input common with respect to earth ground; and the common of the plug-in cards with respect to input common.

CHANGING THE SENSOR OR TARGET: This unit is provided programmed to the specific application requirements as stated by the customer or calculated by Sensor Solutions. Changing the sensor may require changing dip switches located within the meter. Always contact Sensor Solutions before changing the sensor, the target, or the unit programming.

REPROGRAMMING THE METER: Attempting to reprogram the unit without contacting Sensor Solutions may invalidate the warranty. Contact Sensor Solutions to discuss reprogramming options.

REPLACEMENTS, ADDITIONAL UNITS, NEW APPLICATIONS: To order a new meter with the same programming, indicate the 900-14-xxx number listed in the specifications above. If you require different programming or are using different sensors and/or targets contact Sensor Solutions for a new Programming setup form or to discuss the new application.

Sensor Solutions Corp. • V: (970) 879-9900 Fax: (970) 879-9700 • www.sensorso.com • rev A